

## THRUSH AIRCRAFT INC.

## Service Letter No. SL-AG-107

P.O. Box 3149 Albany, GA 31706-3149

Phone (229) 883-1440

Fax (229) 439-9790

Service Bulletin No SL-AG-107 28 October 2004 PAGE 1 OF 1

## **BATTERY VENT SYSTEM PLASTIC TEES INSPECTION**

| All Turbine powered S2R aircraft with dual batteries, built before October 2004.   |  |
|--|--|
|  |  |
| A report from the field indicated of a battery vent tee deteriorating due to not being acid proof. The purpose of this letter is to provide a new part number for an acid-proof Kynar® PVDF $\frac{1}{2}$ " Tee. |  |
| On condition.  |  |
| A&P mechanic or equivalent:  |  |
| Thrush Aircraft, Inc. Engineering  |  |
| 15 minutes.  |  |
| None   |  |
| Look for deterioration of the 2 plastic tees in the battery vent's inlet and outlet system.  |  |
| Replace the two (2 each) plastic tees with two (2 each) $P\!/\!N$ 53055K174 tees.  |  |
| 2 ea. 53055K174 Tee, Kynar® PVDF, $\frac{1}{2}$ , acid-proof   |  |
| No change  |  |
| None   |  |
| Make an entry in the aircraft permanent records as follows:  |  |
| Thrush Aircraft, Inc.'s Service Letter SL-AG-107, Battery vent system plastic tees inspection, dated 28 October 2004 accomplished on(date)   |  |
| Sign and include certificate number.   |  |
|  |  |