

Rockwell service letter No. SL-AG-45

International

P.O. BOX 3090 ALBANY, GEORGIA 31706-3090 PHONE 229/883-1440 FAX 229/439-9790

Service Letter No. SL-AG-45
August 30, 1966

FUEL GAGE MALFUNCTION

APPLICABILITY: ALL S-2C, S-2D Aircraft, Serial Number 1254 through 1374.

On airplanes equipped with fuel gages with externally removable dials in the serial number range noted above, the possibility of malfunction of the gage exists. This condition is due to the fact that a few of the internal magnets were improperly staked to the vertical shaft. Those which have been checked for proper staking will have an "X" stamped into the body of the lower left hand side of the gage.

Inspect gages in airplanes in the above serial number range. If the identifying "X" is not present (on gages with externally removable dials only) notify the factory and new gages will be sent free of charge. Old gages should be returned to the factory after replacement by new gages.

Use gages with caution until this service letter is complied with.