

International

P.O. BOX 3090 ALBANY, GEORGIA 31706-3090 PHONE 229/883-1440 FAX 229/439-9790

Service Letter No. SL-AG-88 8 December, 1976

FLYING WIRE BRACKETS INSTALLATION

MODELS AFFECTED: S-2R, S/N 1825, 1851 thru 2240 AND 5000 thru 5082.

REASON FOR PUBLICATION: Provide improved flying wire brackets.

COMPLIANCE: At next annual inspection.

NOTE

If any problems are encountered while complying with this service letter, contact your nearest Thrush Commander dealer or your Thrush Commander Regional service manager (Reference service information no. SI-123.)

BY WHOM WORK WILL BE

ACCOMPLISHED: A & P Mechanic or equivalent

APPROVAL: FAA DER Approved

ESTIMATED MAN HOURS: Six (6) Hours

PARTS DATA: Parts required to comply with this Service Letter may be purchased

as a kit through your nearest Thrush Commander Dealer for \$79.93. Reference this Service Letter, aircraft model and factory serial number when ordering Service Letter No. SL-AG-88 kit

consisting of the following:

Price subject to change without notice

Qty	Part No.	Description
6 ea	54034-3	Bracket
2 ea	54034-5	Bracket
2 ea	54034-7	Bracket
2 ea	54034-9	Bracket
1 ea	Service Letter No. SL-AG-88	Instructions

SPECIAL TOOLS: Aircraft jacks, incidence fixture, and propeller protractor.

PAGE 1 of 3 SL-AG-88

ACCOMPLISHMENT INSTRUCTIONS:

- 1 Loosen and remove all empennage flying wires.
- 2 Remove and discard existing flying wire brackets (12 places).

NOTE

Retain flying wire bracket attaching hardware for later reinstallation of new flying wire brackets.

- 3 Install 54034-5 bracket (2 places) and 54034-7 bracket (2 places) on vertical stabilizer using existing hardware removed in step 2. (see Figure 1).
- 4 Install 54034-3 bracket (6 places) and 54034-9 bracket (2 places) on horizontal stabilizer using existing hardware removed in step 2. (see Figure 1).
- 5 Reinstall existing flying wires using existing hardware.
- Rerig empennage as outlined in the Model S-2R Airplane Maintenance Manual (Change 2, dated May 14, 1976 or later), Section VII.

ELECTRICAL LOAD: No Change

WEIGHT AND BALANCE: No Change

PUBLICATIONS AFFECTED: The Illustrated Parts Catalog and Maintenance Manual changes

required by this document will be incorporated at the next

scheduled change/revision.

RECORD COMPLIANCE: Make appropriate entry in airplane maintenance records as follows:

Service Letter No. SL-AG-88 dated 23 November 1976, entitled

"Flying Wire Brackets Installation",

accomplished (date) .

PAGE 2 of 3 SL-AG-88

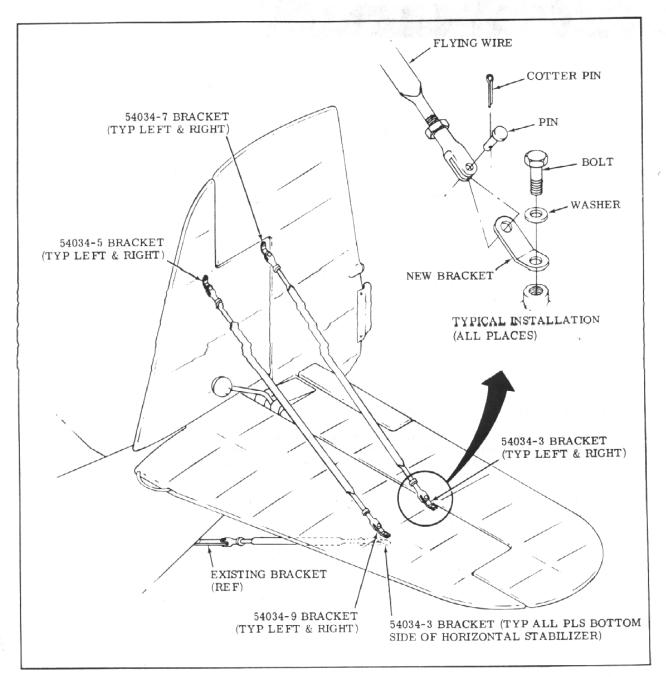


Figure 1.