

Rockwell service letter No. SL-AG-62

International

P.O. BOX 3090 ALBANY, GEORGIA 31706-3090 PHONE 229/883-1440 FAX 229/439-9790

Service Letter No. SL-AG-62
July 13, 1970

TAILWHEEL HOUSING CASTING

EFFECTIVITY: Model S-2R, Serial No. 1416R thru 1540R

APPROVAL: FAA Approved

There have been a few reports of the tailwheel housing casting failing after heavy loading and working from extremely rough strips.

The failure is generally a casting failure across the body of the casting.

This is the casting that houses the tailwheel swivel components and the vertical shaft of the tailwheel fork.

If the aircraft has been operated from an extremely rough strip, an immediate inspection should be made of the casting for evidence of failure.

A new heavier duty casting is available for those who will have to operate with the above mentioned conditions and a replacement with this new heavier casting is recommended.

KIT LIST #62

<u>PART NUMBER</u>	<u># REQUIRED</u>	<u>DESCRIPTION</u>
50333-1	1	Casting-Tailwheel Housing
AN5C-27A	2	Bolt
AN960C-516	5	Washer
AN363C-524	2	Nut
NAS464-5L-39	1	Bolt
AN320C-5	1	Nut
MS24665-151	1	Cotter Pin
50141	1	Drawing