

Rockwell service letter No. SL-AG-77

International

P.O. BOX 3090 ALBANY, GEORGIA 31706-3090 PHONE 229/883-1440 FAX 229/439-9790

Service Letter No. SL-AG-77
30 January, 1976

CARBURETOR AIR INLET SCOOP ASSEMBLY REPLACEMENT

MODELS AFFECTED: MODEL S-2R, S/N 5000 thru 5082.

REASON FOR PUBLICATION: Provide an improved carburetor air inlet scoop.

COMPLIANCE: During next annual inspection.

BY WHOM WORK WILL BE ACCOMPLISHED: A & P Mechanic or equivalent

APPROVAL: FAA DER Approved

ESTIMATED MAN HOURS: Two (2) Hours

PARTS DATA: Parts required to comply with this Service Letter are furnished as a kit, at no charge, by Rockwell International, General Aviation Division, Albany, Georgia, 31702 and consists of the following:

Qty	Part No.	Description
1 ea.	60517-503	Scoop
1 ea	Service Letter SL-AG-77	Instructions
1 ea		Compliance Card

SPECIAL TOOLS: None

ACCOMPLISHMENT INSTRUCTIONS:

1. Inspect existing carburetor air inlet scoop, located on right side of upper engine cowling, to assure scoop installed is manufactured from aluminum material.
2. If scoop is manufactured from aluminum material, proceed to RECORD COMPLIANCE.

3. If scoop is manufactured from fiberglass material, proceed to step 4.
4. Remove upper engine cowling.
5. Remove and discard existing carburetor air inlet scoop from upper engine cowling.
6. Locate, drill and install 60517-503 scoop picking up existing holes in upper engine cowling (see Figure 1.).
7. Reinstall upper engine cowling.
8. Fill out and mail Compliance Card.

ELECTRICAL LOAD: No Change

WEIGHT AND BALANCE: No Change

PUBLICATIONS AFFECTED: The Illustrated Parts Catalog change required by this document will be incorporated at the next scheduled change/revision.

RECORD COMPLIANCE: Make appropriate entry in airplane maintenance records as follows:

Service Letter No. SL-AG-77 dated 30 January 1976, entitled "Collector Ring Replacement", accomplished (date).

